



THE OWNER/ARCHITECT/CONTRACTOR IS ADVISED THAT M.T.E. CONSULTANTS INC. CANNOT CERTIFY ANY COMPONENT OF THE SITE WORKS NOT INSPECTED DURING CONSTRUCTION. IT IS THE RESPONSIBILITY OF THE GENERAL CONTRACTOR TO NOTIFY M.T.E. CONSULTANTS INC. PRIOR TO COMMENCEMENT OF CONSTRUCTION TO ARRANGE FOR INSPECTION.



NTS

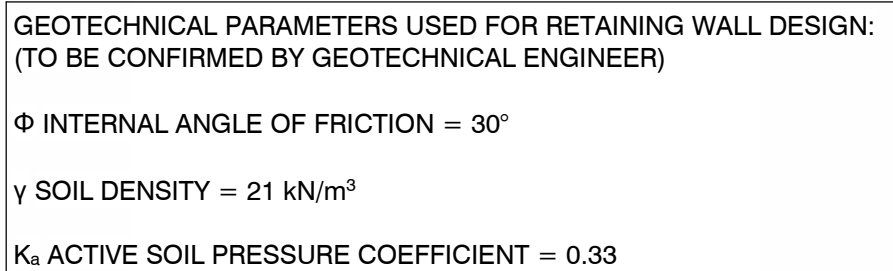


1 : 20

1. CONSTRUCTION JOINTS SHALL BE MADE AND LOCATED SO AS NOT TO IMPAIR THE STRENGTH OF THE STRUCTURE. IF
2. JOINTS ARE NOT SPECIFICALLY LOCATED AND/OR THERE IS ANY DOUBT CONCERNING THEIR LOCATION, THE
3. CONTRACTOR SHALL CONSULT WITH THE ARCHITECT.
4. WHERE A CONSTRUCTION JOINT IS TO BE MADE, THE SURFACE OF THE SET CONCRETE IS TO BE THOROUGHLY
5. CLEANED OF ALL FOREIGN MATTER AND LAITANCE, SATURATED WITH WATER AND BE LEFT IN A DAMP CONDITION WITH
6. A FINISH MATERIAL TO BE APPLIED IMMEDIATELY AFTER PLACING THE NEXT CONCRETE.
7. REINFORCING PROJECTING THROUGH A JOINT SHALL BE THOROUGHLY CLEANED OF LOOSE FLAKY RUST, MUD,
8. OIL DRIED CONCRETE OR OTHER COATINGS WHICH WOULD DESTROY OR REDUCE BOND.
9. FOR FORMED SLABS AND BEAMS, FORMS & SHORES TO REMAIN IN PLACE ON BOTH SIDES OF JOINT UNTIL CONCRETE IN
10. JOINT HAS ACHIEVED ITS SPECIFIED DESIGN STRENGTH.
11. FOR JOINTS IN SLAB-ON-GRADE, SEE SEPARATE TYPICAL DETAIL.



TYP. JOINTS IN CONCRETE MEMBERS (N.T.S.)

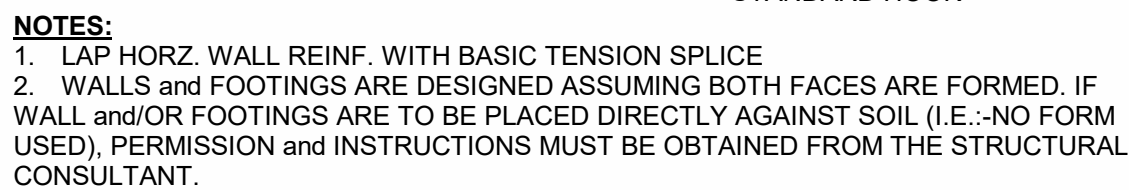

TYP. CONCRETE WALLS DETAILS (N.T.S.)



THE OWNER/ARCHITECT/CONTRACTOR IS ADVISED THAT M.T.E. CONSULTANTS INC. CANNOT CERTIFY ANY COMPONENT OF THE SITE WORKS NOT INSPECTED DURING CONSTRUCTION. IT IS THE RESPONSIBILITY OF THE GENERAL CONTRACTOR TO NOTIFY M.T.E. CONSULTANTS INC. PRIOR TO COMMENCEMENT OF CONSTRUCTION TO ARRANGE FOR INSPECTION.

www.mte85.com

INSITE PROJECT
CONSULTING

PROJECT

WEST MEADOW
PHASE 2 APARTMENTS
RETAINING WALL

SE GEORGE WRIGHT BLVD & BEASLEY CRESC. PICTON, ON

DRAWING

SECTION, ELEVATION & DETAILS

S2.0